

## CHEMICAL PROCESSES OF GEOTHERMAL FLUID IMPACT ON METAL OF GEOTHERMAL HEATING SYSTEM EQUIPMENT

Oana STĂNĂȘEL, Gabriela BADEA, Iulian STĂNĂȘEL,  
Alina CĂRĂBAN, Georgeta GAVRIȘ  
University of Oradea, [ostanasel@uoradea.ro](mailto:ostanasel@uoradea.ro)

Keywords: Felix Spa, cast iron coupons.

### ABSTRACT

This paper emphasizes a low temperature geothermal well from north western part of Romania. The main aim when exploiting a production well is to have continuous operation. Water that is discharged into the environment needs to comply with international safety standards and must not cause damage to installations either by deposition or corrosion. In addition to water analysis, thermodynamic calculations and possibly laboratory experiments may be needed to ascertain its safety. The chemical composition should be monitored regularly during production.

Results of corrosion tests conducted on a selection of four metallic coupons that have been placed in the water circuit at Felix, Romania are described. Corrosion tests were conducted using aluminium, carbon steel, stainless steel, cast iron coupons involving different exposure periods to fluids. Scale deposition, caused by corrosion and mineral precipitation from the water, were chemical and XRD analysed.

### 1. INTRODUCTION

Felix geothermal resort located at about 6 km to Oradea is the most useful place for balneological treatment in Romania. The waters which spring up at Felix come from the lower cretaceous system. Felix Spa has a large experience in treating degenerative and inflammatory rheumatism – an experience based on a cure methodology specific to this resort. As a result of the medical research and experiments the following diseases are treated at Felix: chronic inflammatory rheumatism, rheumatismal degenerative diseases, post-traumatic diseases, troubles of the nervous system, associated diseases of the main profiles mentioned above. Considering the outstanding special therapeutic properties of the geothermal water from Felix Spa this thermomineral water was taken for analysis. The wellhead temperature measured during sampling was 42°C. The results of the laboratory analysis indicated that geothermal waters from the studied well from Felix are slightly basic. The mineralisation of water is very low<sup>1</sup>. The chloride content is low and the sulphate is higher. The water is carbonated-calcium sulphate type.

### 2. SCALE AND CORROSION-LITERATURE REVIEW

Depending on the chemical composition of the geothermal well fluids, different types of scales are found in various geothermal areas. Damage in the exploitation equipments can occur in the form of metal corrosion and deposition on material surfaces of scale species. Once the geothermal water is available for use, prevention of scaling and corrosion is very important. Calcite, silica and sulphide are the most common solid depositions encountered in geothermal systems<sup>2</sup>. Corrosive products are a second source of scale forming species.

The species of interest related to corrosion are hydrogen ion, chloride, hydrogen sulphide, carbon dioxide, oxygen. The corrosion rate of most materials increases as pH decreases. A pH below 6.5 in water with high CO<sub>2</sub> content makes possible a stress corrosion cracking of iron and steel. Higher values than 8 are usually associated with water that causes localized pitting, especially if dissolved oxygen is present. It may be

possible to be associated with carbonate deposits. A very low concentration of 5 to 10 ppm  $\text{Cl}^-$  in the presence of oxygen can promote stress corrosion cracking in stainless steel. A high chloride concentration increases the solubility of iron in geothermal water by forming highly soluble complexes with the ferric ion.

A low concentration of hydrogen sulphide may have corrosion effect especially on Cu and Ni alloys. The threshold concentration for attack is less than 30 ppb  $\text{H}_2\text{S}$ . The presence of hydrogen sulphide in low temperature geothermal water could be a reason to suspect the existence of sulphide-reducing bacteria.

Carbon dioxide occurs naturally in many geothermal waters and has a major corrosive effect on steel. It has been noticed a very high uniform corrosion rate in the presence of carbon dioxide and sodium chloride up to  $80^\circ\text{C}$ . An elevated temperature is most damaging to well water of high carbon dioxide content and low pH.

Oxygen is present in low concentrations in geothermal waters, but even traces of this gas accelerate corrosion<sup>3</sup>. The geothermal water may come into contact with the atmosphere during reinjection or if pumps other than downhole submersibles or oxygen might be one of the natural components in a gas accompanying the water<sup>5</sup>. The corrosion of carbon steels is sensitive to very low concentration of oxygen. Together with chloride ion, oxygen can initiate stress corrosion cracking. A concentration that exceeds 15 ppb of oxygen in hot water is needed to cause localized corrosion and pitting. At low oxygen level the corrosion products are mainly iron sulphides. As the oxygen level increases, magnetite becomes the major product.

Scale deposition can influence the corrosion of metals. Very often scale deposits accelerate corrosion rate. Iron sulphide deposits can cause severe pitting corrosion. The presence of any type of deposit in water containing hydrogen sulphide, oxygen or carbon dioxide will often increase the severity of any potential corrosion problem.

### 3. RESULTS AND DISCUSSIONS

#### 3.1 Corrosion rates

Corrosion tests were conducted using a set of four metal coupons exposed to fluids from Felix well. The metal coupons used were: carbon steel, stainless steel, cast iron and aluminium. They were exposed for periods ranging between 360 and 2040 hours. The coupons were weighed to 0.001 g accuracy before introducing them into the test. Changes in weight after immersion in the geothermal water were used to determine the effects of corrosion for each kind of coupon (Tables 1 - 4).

$$CR = \frac{\Delta G}{S \cdot t} \cdot \frac{8760}{\rho} \quad (1)$$

where  $CR$ ,  $t$ ,  $S$ ,  $\Delta G$ ,  $\rho$ ,  $constant$  are: corrosion rate in mm/year; exposed time, in hours; exposed area of test material, in  $\text{m}^2$ ; weight loss, in g; test material density, in  $\text{kg}/\text{m}^3$ ; 8760, in hours/year, respectively.

Table 1. Material loss and corrosion rate results

Time, hours	Stainless steel	
	$\Delta G$ [g]	CR [mm/year]
360	0.0037	0.0025
672	0.0028	0.0010
1440	0.0024	0.0004
2040	0.0019	0.0002

Table 2. Material loss and corrosion rate results

Time, hours	Carbon steel	
	$\Delta G$ [g]	CR [mm/year]
360	0.9302	0.640
672	1.4434	0.532
1440	2.6629	0.458
2040	2.817	0.342

Table 3. Material loss and corrosion rate results

Time, hours	Cast iron	
	$\Delta G$ [g]	CR [mm/year]
360	0.8343	0.574
672	0.9903	0.365
1440	1.5931	0.274
2040	1.7791	0.216

Table 4. Material loss and corrosion rate results

Time, hours	Aluminium	
	$\Delta G$ [g]	CR [mm/year]
360	0.0232	0.0465
672	0.0340	0.0365
1440	0.0603	0.0302
2040	0.0724	0.0256

The data from tables 1 to 4 indicates that the corrosion rate is higher in the first month of testing. The corrosion process decreases then probably due to some corrosion products as iron oxides, which have a little adherence and a high porosity. Experimentally it was noticed a uniform corrosion at the beginning and then a tendency to pitting corrosion.

Corrosion rate varies, depending on the material, the lowest values being recorded for stainless steel, followed by aluminium, cast iron and carbon steel. The recommended material in geothermal installations is stainless steel that has an extremely low corrosion rate, maybe due to a protective layer<sup>4</sup>. An acceleration of the corrosion effect might appear in waters with a high chloride content.

Aluminium even if is less exposed to corrosion attack than cast iron or carbon steel is not recommended for the equipments used in geothermal exploitation, because a significant pitting corrosion has been remarked.

### 3.2 Scale analysis from Felix

At Felix solid depositions were observed in the distribution system during utilization. The scale was chemically analysed, the results being summarized in Table 5. The solid sample was analysed by X-ray diffraction<sup>6,7</sup>, using  $K\alpha$ Cu radiation. The sample consists

mainly in calcite. The amorphous phase has a high Fe content and for this reason an elevated baseline appears on XRD diagram (Figure 1). This is due to the corrosion of the pipe.

Table 5. Chemical composition of the scale deposits from Felix, in %

Al <sub>2</sub> O <sub>3</sub>	CaO	MgO	Fe <sub>2</sub> O <sub>3</sub>	Na <sub>2</sub> O	Calcinated loss
0.3	53	1.2	2.2	0.8	42.4

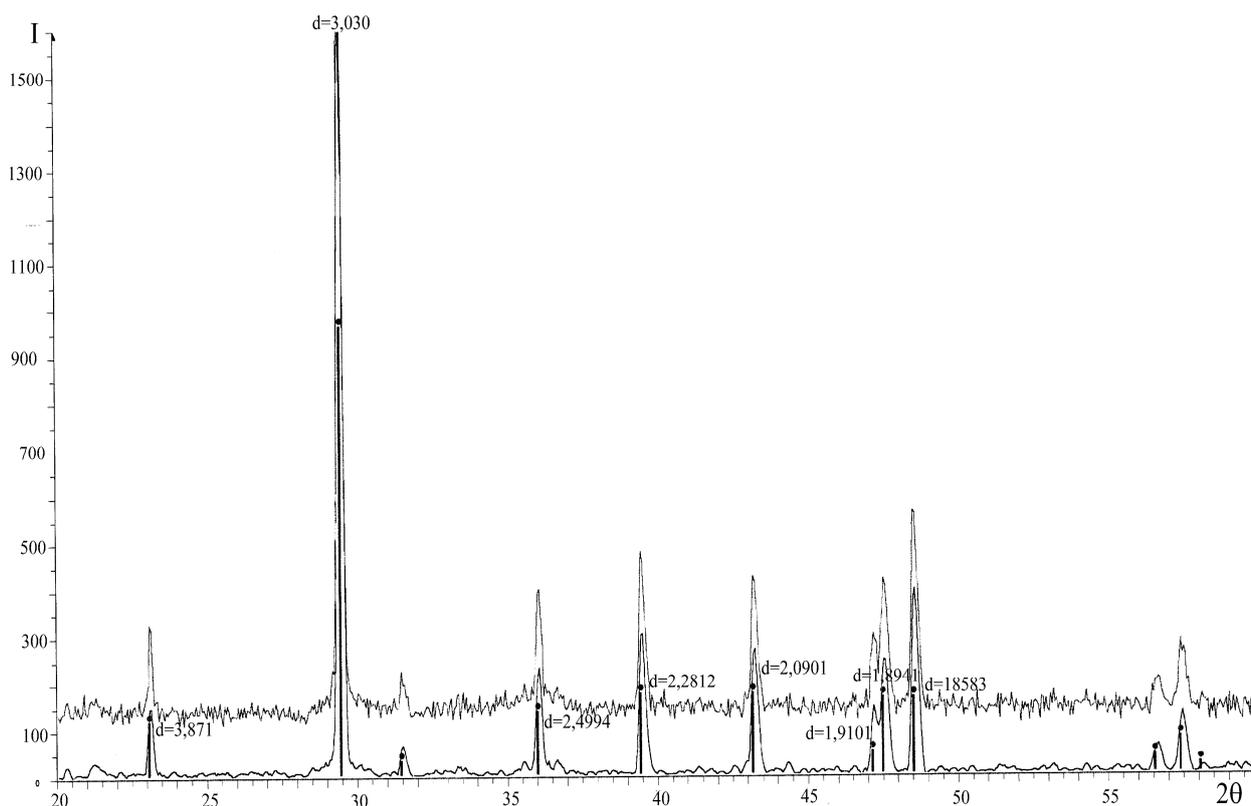


Figure 1: The XRD diagram for depositions from Felix.

#### 4. CONCLUSIONS

Taking into account the results of water analysis from Felix, a corrosion process can be estimated. The high CO<sub>2</sub> content could be a good corrosion supply. The chloride concentration is under 10 ppm, but maybe there are traces of oxygen, which accelerate corrosion. The high carbon dioxide content and the calcium concentration of the water can lead to calcium carbonate deposit

According to corrosion rate data you can choose stainless steel for the exploitation equipments of geothermal waters. Carbon steel is very exposed to corrosion, which was also found by the solid deposits formed during utilization. It was proved by chemical and structural analysis that in solid sample iron is in its content due to corrosion, besides the calcite scale. A chemical inhibition system might be a promising method to combat scaling both technically and economically as compared to mechanical methods.

## REFERENCES

- [1] Opondo, K. M.: *Corrosion tests in cooling circuit water at Olkaria I plant and scale predictions for Olkaria and Reykjanes fluids*, Report 10 in Geothermal Training in Iceland, UNU G.T.P., Iceland, p.147-187, 2002.
- [2] Stănăşel, O., Kristmannsdottir, H., Gilău, L.: *Chemical interpretation and scaling potential in Oradea geothermal area, Romania*, Proceedings, 27<sup>th</sup> Workshop on Geothermal Reservoir Engineering, Stanford University, Stanford, CA, p.411-414, 2002.
- [3] Ungemach, P.: *Handling of corrosion and scaling shortcomings in low enthalpy geothermal environments*, European Summer School on Geothermal Energy Applications, p. 113-127, 2001.
- [4] Stănăşel, O., Stănăşel, I.: *Corrosion tests and the use of inhibitors in low temperature geothermal waters*, CD Proceedings of the World Geothermal Congress, Antalya, Turkey, 24-29 April 2005.
- [5] Manea, F., Radovan, C., Vlaicu, I.: *Electrochemical assessment of amperometric oxidability level in water pollution monitoring*, Buletinul Ştiinţific al Universităţii "Politehnica" din Timişoara, vol.50 (64), 1-2, p. 5-9, 2005.
- [6] Cullity, B.D.: *Elements of X-Ray Diffraction*, 2<sup>nd</sup> ed. USA, p. 397, 1978.
- [7] <sup>xxx</sup> *Mineral Powder Diffraction File. Data Book*, International Centre for Diffraction Data 1601 Park Lane Swarthmore, PA 19081, USA, 1986.